

## Airworthiness Directive

### ▶ Federal Register Information

#### ▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

Amendment 39-700; AD 64-07-03

FLOTTORP Models F12A-3 and F12A-5 Series Propellers

**PDF Copy (If Available):**

#### ▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

DATES: Effective April 10, 1964.

#### ▼ Regulatory Information

**64-07-03 FLOTTORP:** Amdt. 700 Part 507 Federal Register March 11, 1964. Applies to All F12A-3 and F12A-5 Series Propellers with FS200-1 Propeller Spinner.

Compliance required as indicated.

Within 15 hours' time in service after the effective date of this AD, accomplish the following rework unless already accomplished:

Remove the six AN 4H7A bolts attaching the 248-1 spinner bulkhead to the propeller flange and reinstall six shorter AN 4H6A bolts. The old AN 960-416L washers may be reused. Torque bolts to 70 to 90 inch- pounds. Safety wire all boltheads with MS20995-C32 safety wire.

This directive effective April 10, 1964.

▼ **Footer Information**

▼ **Comments**

[FAA.gov Home](#) | [Privacy Policy](#) | [Web Policies & Notices](#) | [Contact Us](#) | [Help](#)

**Readers & Viewers:** [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)