



ENGINE COMPANY, INC. SYRACUSE 8, NEW YORK

FAA APPROVED
SERVICE BULLETIN

No. 105

Date: 15 May 1963

SUBJECT: Removal of a specific lot of P/N 19751
Connecting Rods from use.

| | | |
|------------------|--------------|------------|
| MODELS AFFECTED: | 6VS-335 | All Series |
| | 6V-335 | " " |
| | 6V4-200, 178 | " " |
| | 6A-335 | " " |
| | 6A4-150, 165 | " " |

COMPLIANCE: Next Major or Top Overhaul.

1. A study of P/N 19751 Connecting Rods rejected at overhaul for magnetic indications at the pin end and several which failed at the same point indicates that the problem is confined to a particular lot of rods which were manufactured between July and September 1960. These rods are marked on the I-Beam section as follows:

HI 11 R11 G3E

2. At the next top or major overhaul, inspect all connecting rods for the above identification. All rods so marked will be removed from the engine and destroyed to preclude possible reuse. Replace with P/N 19751 Connecting Rod having any identifying marks other than those in paragraph 1. above.