

SERVICE BULLETIN

STINSON DIVISION
CONSOLIDATED VULTEE AIRCRAFT CORPORATION
WAYNE, MICHIGAN

TITLE Replacement of Elevator Cable Fairlead

BULLETIN NO. 230

MODELS AFFECTED: 108 (Voyager 150)
Serial 108-1 through 108-50

PAGE 1 OF 1

DATE March 19, 1946

Service has revealed that the lower elevator cable fairlead installed on a fuselage tube at station 100.00 (approximately 14" aft of rear cabin curtain) is of insufficient durability and should be replaced with a heavier hard red fibre block as shown on Figure 1.

Access to the fairlead may be gained by removing the rear seat hammocks and opening the rear cabin curtain.

Remove the present fairlead by grinding off the heads of the drive screws with which it is attached. Hammer these screws flush with the tube surface after removal of the fairlead.

Necessary parts, tabled below, may be secured by contacting our Service Department and advising the serial number of the plane for which they are required.

PARTS REQUIRED

1 - 108-3041000-26	Fibre
2 - AN-526-1032-8	Screw
2 - AN-365-1032	Nut
2 - AN-742-8	Clamp

The subject fairlead has been incorporated into airplanes bearing serial 108-151 and up.

