

SERVICE BULLETIN

STINSON DIVISION
CONSOLIDATED VULTRE AIRCRAFT CORPORATION
WAYNE, MICHIGAN

TITLE: Accelerator Pump Kit, Part A666-581, For
Engines With The Marvel-Schebler MA-3-SPA Carburetor
MODELS AFFECTED: Stinson Voyagers, Serial No.
108-1 through 108-2249

BULLETIN NO. 255

PAGE 1 OF 1

DATE: February 20, 1948

Gentlemen:

For your information, we are quoting below the contents of Service Bulletin No. 61 issued by Aircooled Motors, Inc.

"Due to reports received from the field to the effect that accelerator pump linkage on Marvel-Schebler carburetors model MA-3-SPA in some cases was causing a binding action on Franklin engines, model 6A4-150-B3, B31, Marvel-Schebler have developed a replacement kit, part A666-581, to eliminate this difficulty.

These kits sell for \$2.00 list price and may be procured through Marvel-Schebler Carburetor Division, Borg-Warner Corporation, Flint, Michigan, or through their authorized distributor and service stations. A small supply of kits will also be carried by Aircooled Motors, Inc., for your convenience.

The kits consist of the following parts:

A194-593	Pump Plunger Assembly
A17-383	Connecting Rod
A155-307	Pump Lever
A82-11	Cotter Key

To avoid danger of throttle sticking, it is requested that upon receipt of this bulletin you check engines with the Marvel-Schebler MA-3-SPA carburetor for worn accelerator pump linkage. If worn, parts should be replaced using kit A666-581.

Inspection of these parts should be made as part of each regular 25 hour inspection to insure replacement of the parts before excessive wear occurs to cause any binding action."

Yours very truly,

CONSOLIDATED VULTRE AIRCRAFT CORPORATION

George Martin
George Martin
Service Manager