

SERVICE BULLETIN

STINSON DIVISION

CONSOLIDATED VULTEE AIRCRAFT CORPORATION

WAYNE, MICHIGAN

TITLE Carburetor Air Filter - Winter Precaution

BULLETIN NO. 244


MODELS AFFECTED: 108 (Voyager 150)

PAGE 1 OF 1

DATE October 24, 1946

It is recommended that the filter be removed from the carburetor air intake scoop during winter operations in areas where snow is likely to be encountered. This is a precautionary measure to prevent the air scoop from being plugged by snow and causing engine failure.

To accomplish this, remove the narrow door aft of the oil cooler fairing in the bottom engine cowl. Pull the air filter down and back to remove.

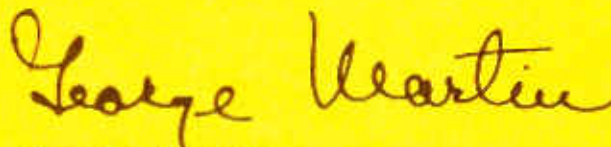

George Martin
Parts and Service Department